

TECHNICAL INFORMATION #920

ZIB-113

To: ICOM Distributors

From: ICOM Inc. / CS Department

Date: October 15, 2002

Service handling necessary:

☒ Yes ☐ No

Re: IC- 7400/IC-746PRO Modification No.124

The following modification is regarding the improvement of IC-7400 and IC-746PRO.

Symptom: No output power on the TX mode.

Cause: The IC151 is damaged because of static electricity.

Solution: Add two PIN diodes on receiving line as follows,

Board	Parts Number	Parts Number (Old)	Parts Number (New)	Action Taken
RF 130	D.1	NA	1750000350	Add
			S.DIODE TOSHIBA 1SV252	
RF 130	D.2	NA	1750000350	Add
			S.DIODE TOSHIBA 1SV252	



